

Dimensions

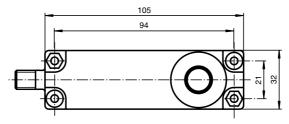

Bore hole and countersinking for screws/hexagon M4



Features

- Switch output
- 5 different output functions can be set

33 O

- TEACH-IN input
- · Synchronisation options
- · Deactivation option
- Temperature compensation

Electrical connection

+ U_B

- Teaching input

Synchronous

Switch output

Standard symbol/Connections:

1 (BN)

2 (WH)

5 (GY)

4 (BK)

3 (BU)

Core colours in accordance with EN 60947-5-2.

(version E5, pnp)

U

Technical data

CE

General specifications

30 ... 500 mm Sensing range Adjustment range 50 ... 500 mm Unusable area 0 ... 30 mm 100 mm x 100 mm approx. 380 kHz Standard target plate Transducer frequency Response delay

Indicators/operating means LED green

LED vellow

LED red

permanently green: monitoring system green flashing: TEACH-IN function indication of the switching state flashing: TEACH-IN function object detected

Ilashing: TEACH-IN function: object detected permanently: TEACH-IN mode, object uncertain

Electrical specifications

Operating voltage No-load supply current I₀

Input/Output

Synchronisation

10 ... 30 V DC , ripple 10 %SS

≤ 55 mA

1 synchronous input 0 level: -U_B...+1 V 1 level: +4 V...+U_B input impedance: > 12 KOhm

synchronisation pulse: 0.1 ... 8 ms

Common mode operation ≤ 100 Hz \leq 100 / n Hz, n = number of sensors

Synchronisation frequency Multiplex operation

Input

Input type

1 TEACH-IN input, switching point A1: -U_B ... +1 V, switching point A2: +4 V ... +U_B input impedance: > 4.7 k Ω , TEACH-IN pulse: \geq 1 s

Output

Output type 1 switch output E5, pnp NO/NC

Repeat accuracy ≤ 1 % of full-scale value Rated operational current Ie 200 mA, short-circuit/overload protected

Voltage drop U_d \leq 3 V Switching frequency f

max. 10 Hz Range hysteresis H \leq 1 % of the set operating distance ± 1,5 % of full-scale value Temperature influence

Standard conformity Standards

Ambient conditions Ambient temperature

Storage temperature

Mechanical specifications Protection degree

Connection Material Housing Transducer -25 ... 70 °C (248 ... 343 K) -40 ... 85 °C (233 ... 358 K)

IP65

EN 60947-5-2

connector V15 (M12 x 1), 5 pin

epoxy resin/hollow glass sphere mixture; polyurethane foam

100 g

104715_ENG.xml

Connector V15



Mass

Synchronisation

The sensor features a synchronisation input for the suppression of mutual interference. If this input is not used, the sensor will operate using an internally generated clock rate. The synchronisation of multiple sensors can be realised as follows:

External synchronisation

The sensor can be synchronised by the external application of a square wave voltage. A synchronisation pulse at the synchronisation input starts a measuring cycle. The pulse must have a duration greater than 100 μs . The measuring cycle starts with the falling edge of a synchronisation pulse. A low level >1 s or an open synchronisation input will result in the normal operation of the sensor. A high level at the synchronisation input disables the sensor.

Two operating modes are available

- Multiple sensors can be controlled by the same synchronisation signal. The sensors are synchronised.
- The synchronisation pulses are sent cyclically to individual sensors. The sensors operate in multiplex mode.

Internal synchronisation

The synchronisation connections of up to 5 sensors capable of internal synchronisation are connected to one another. When power is applied, these sensors will operate in multiplex mode. The response delay increases according to the number of sensors to be synchronised. Synchronisation cannot be performed during TEACH-IN and vice versa. The sensors must be operated in an unsynchronised manner to teach the switching point.

Note:

If the option for synchronisation is not used, the synchronisation input has to be connected to ground (0V) or the sensor has to be operated via a V1 cable connector (4-pin).

Adjusting of switching points

The ultrasonic sensor features a switch output with two teachable switching points. These are set by applying the supply voltage -U $_{\rm B}$ or +U $_{\rm B}$ to the TEACH-IN input. The supply voltage must be applied to the TEACH-IN input for at least 1 s. LEDs indicate whether the sensor has recognised the target during the TEACH-IN procedure. Switching point A1 is taught with -U $_{\rm B}$, A2 with +U $_{\rm B}$.

Five different output functions can be set

- 1. Window mode, normally-open function
- 2. Window mode, normally-closed function
- 3. One switching point, normally-open function
- 4. One switching point, normally-closed function
- 5. Detection of object presence

TEACH-IN window mode, normally-open function

- Set target to near switching point
- TEACH-IN switching point A1 with -UB
- Set target to far switching point
- TEACH-IN switching point A2 with +U_B

TEACH-IN window mode, normally-closed function

- Set target to near switching point
- TEACH-IN switching point A2 with +U_B
- Set target to far switching point
- TEACH-IN switching point A1 with -UR

TEACH-IN one switching point, normally-open function

- Set target to near switching point
- TEACH-IN switching point A2 with +U_B
- Cover sensor with hand or remove all objects from sensing range
- TEACH-IN switching point A1 with -U_B

TEACH-IN one switching point, normally-closed function

- Set target to near switching point
- TEACH-IN switching point A1 with -UB
- Cover sensor with hand or remove all objects from sensing range
- TEACH-IN switching point A2 with +U_B


TEACH-IN detection of object presence

- Cover sensor with hand or remove all objects from sensing range

UB500-F54-E5-V15


Characteristic curves/additional information

Characteristic response curve

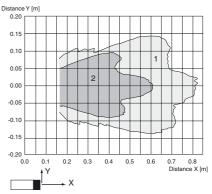

Curve 1: flat surface 100 mm x 100 mm Curve 2: round bar, Ø 25 mm

Programmed switching output function

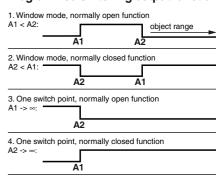

5. A1 -> ∞, A2 -> ∞: Detection of object presence Object detected: Switch output closed No object detected: Switch output open

Accessories

Programming unit

UB-PROG2

Cable sockets *)

V15-G-2M-PVC V15-W-2M-PUR

*) For additional cable sockets see section "Accessories".

Ultrasonic sensor

UB500-F54-E5-V15

- TEACH-IN switching point A1 with -U $_{\rm B}$
- TEACH-IN switching point A2 with +UB

Default setting of switching points

A1 = unusable area

A2 = nominal sensing range

LED Displays

Displays in dependence on operating mode	Red LED	Yellow LED	Green LED
TEACH-IN switching point:			
Object detected	off	flashes	flashes
No object detected	flashes	off	flashes
Object uncertain (TEACH-IN invalid)	on	off	flashes
Normal operation	off	switching	on
		state	
Fault	flashes	previous state	off